# Brass manifold combination adapter fitting adapters

## Project information


| | |
|---|---|
| Job name: | Location: |
| Engineer: | Date submitted: |
| Contractor: | Submitted by: |
| Manufacturer's representative: | Approved by: |

## Technical data

| | |
|---|---|
| Material | Brass |
| End type 1 | ISO 228-G 1-1/4" |
| Temp/pressure ratings | 73 °F (23 °C) at 160 psi (11 bar)<br>180 °F (82 °C) at 100 psi (6.9 bar)<br>200 °F (93 °C) at 80 psi (5.5 bar) |
| Prop 65 label required? | Yes |

## Product information and application use

The Uponor Brass Manifold Combination Adapter/Fitting Adapter connects Uponor TruFLOW™ and Engineered Polymer (EP) Heating Manifolds to copper connections in radiant heating and cooling applications.

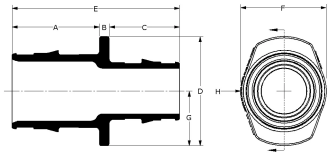


| | Part name | Part no. | A [inch] | B [inch] | C [inch] | D [inch] | E [inch] | F [inch] | G [inch] | H [inch] | End Type 2 | End Type 3 |
|---|---|---|---|---|---|---|---|---|---|---|---|---|
| ✔ | Brass Manifold Adapter, R32 x 3/4" Adapter or 1" Fitting Adapter | A4143210 | 1 | 0.35 | 0.635 | 1.96 | 1.985 | 1.75 | 0.98 | 0.875 | Sweat 3/4" | Sweat 1" |
| | Brass Manifold Adapter, R32 x 1" Adapter or 1 1/4" Fitting Adapter | A4133210 | 1.05 | 0.35 | 0.635 | 1.96 | 2.035 | 1.75 | 0.98 | 0.875 | Sweat 1" | Sweat 1-1/4" |
| | Brass Manifold Adapter, R32 to 1 1/4" Adapter or 1 1/2" Fitting Adapter | A4123215 | 1.2 | 0.35 | 0.63 | 1.96 | 2.18 | 1.75 | 0.98 | 0.875 | Sweat 1-1/4" | Sweat 1-1/2" |

| | Part name | Part no. | Weight per UOM [lbs/UOM] |
|---|---|---|---|
| ✔ | Brass Manifold Adapter, R32 x 3/4" Adapter or 1" Fitting Adapter | A4143210 | 0.62 |
| | Brass Manifold Adapter, R32 x 1" Adapter or 1 1/4" Fitting Adapter | A4133210 | 0.62 |
| | Brass Manifold Adapter, R32 to 1 1/4" Adapter or 1 1/2" Fitting Adapter | A4123215 | 0.62 |

| Part name | Part no. | Codes | Standards | Listings |
|---|---|---|---|---|
| Brass manifold combination adapter fitting adapters | All | IMC\|IRC\|NBC of Canada\|UMC | CSA B137.5\|R32: ISO 228-G 1¼"\|ASTM F877 | cNSFus-rfh |

## Installation

R32 threads into the Uponor TruFLOW and EP Heating Manifolds. Copper sweats to adapter or fitting adapter. For more information, refer to the Uponor Radiant Installation Handbook.

## Related applications

Radiant Heating and Cooling Systems

## Notes

Sweat to copper pipe or fittings

## Footnotes

-

## Contact information

Uponor Inc.
5925 148th Street West
Apple Valley, MN 55124
T 800.321.4739
F 952.891.2008

Uponor Ltd.
6510 Kennedy Road
Mississauga, ON L5T 2X4
T 888.594.7726
F 800.638.9517

© 2026 Uponor North America. All Rights Reserved